



Dart Hawkesbury
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

D4680-041

Job Sheet 167059-A



Part No: D4680-041

Job Qty: 1 ea

Part Name: Skidtube Assembly



Part Weight: 0 lbs

Status: Scheduled

Priority: Medium

Job Created: 10/23/17

Job Tracking No:

Due Date: 11/10/17

Created By: Victoria Michaud-Febrille

Type: Stock

Description:

Note: European warehouse transfer

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier	
					Setup hrs	Run Hrs	Workcenter / Supplier	Lead Time
90	Start up Operation	1 Ea		11/9/17	0.00	0.00	Start Up Skidtubes	
120	Skidtubes	1 pcs		11/9/17	0.00	4.86	Skidtubes	BE 17-10-31
140	QC	1 pcs		11/9/17	0.00	0.00	QC5	17-11-9-24
150	HandFinish	1 pcs		11/9/17	0.00	0.73	HandFinish1	2017-11-13-75L
160	QC	1 pcs		11/9/17	0.00	0.00	QC7	BE
170	Skidtubes	1 pcs		11/9/17	0.00	4.86	Skidtubes	17-11-9-24
180	QC	1 pcs		11/9/17	0.00	0.00	QC5	17-11-9-24
210	HandFinish	1 pcs		11/9/17	0.00	0.73	HandFinish2	17-11-9-24
220	Powdercoat	1 pcs		11/9/17	0.00	0.17	Powdercoat1	BR 18-2-20
230	QC	1 pcs		11/9/17	0.00	0.00	QC3	3EB 18-02-20
260	HandFinish	1 pcs		11/10/17	0.00	0.73	HandFinish4	BE 18-03-20
270	QC	1 pcs		11/10/17	0.00	0.00	QC5	
300	Packaging	1 pcs		11/10/17	0.00	0.00	Packaging3	DAS Sm3
310	QC21-SA	1 Ea		11/10/17	0.00	0.00	QC21	21 FEB 2 1 2018

PK002

Part Op 120 - 1-Cut Aft end as per dwg D4680 3-Drill Aft & Fwd Cap holes using DT8678 & DT8901 open aft cap DT8678 4- Locate
Descriptions: DT10149 & Drill Ground wire hole on top of Tube. 5-Locate DT10149 with 0.187" cleco in aft cap, then Pilot Drill all X-Bolt
holes using 0.187" drill. 6-Open ground wire hole .297" at 95.75" (1 at fwd end & 2 at aft end at 20.81" ref.) 8- 3 most fwd
x-bolt holes must be laid out manually, open to #30. 9-Open Aft & Fwd Cap holes using .208" drill. 10- Open X-Bolt holes
to .750" (10 places) 11- Drill Rivet Holes as per Dwg D4680 using DT10065 ***DO NOT DRILL RIVET HOLES ON
SECTION G-G (TWO PLACES) Open G-G to .750 12-Debur holes.
170 - 1- Bond web as per Dwg D4680 & QSI 015 2- Seal all faying surfaces using proseal and rivet Doubler as per Dwg
D4680, A/R Proseal Batch: 138708 exp date: 5/18 ***LET IT CURE FOR 7HRS*** START
TIME: 18-02-15 FINISH TIME: 18-02-16 3- Rivet doublers as per dwg Shave rivet as required, remove
Proseal spill over. 4- Ream holes section C-C as per dwg, deburr 8 places 5- Swage x-bolt spacers as per Dwg D4680
and section C-C 8 places. 6- Swage x-bolt spacer as per dwg D4680 section G-G 7- Trim/Grind flush per QSI 002
210 - Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch
220 - START TIME: 11:00 O.V.T. 18-02-16 FINISH: 11:30 M 18-02-16
260 - 1- Install Ground Wire inserts as per Dwg D4680. 3- Install Fwd & Aft caps as per Dwg D4680 and Detail "A" & "B".
Fasterner must be install wet as per note (9). 4- Wing Walk as per Dwg D4680 and QSI 005 4.4

Job Allocations

Operation	Component Part	Required	Inventory	Allocated	Std Qty
90-Start up Operation	D4680-041-BENT 163755	1	6	0	0
	D5520-1 164764	2	18	0	0
170-Skidtubes	CR3212-5-05 138325	68	536	0	0
	D4681-041 5007300	1	1	0	0

260-HandFinish

ALS4 AELS-1032-1305 007279

AN3C4A 5019394 3

AN3C5A 5019396 2

AN526C1032R10 F113757-4 2

D2965 F99551 1

D2965-3 F126369 1

D4686-1 S014376 8

D5304-1 S018583 2

MS20601-AD4W3 S016824 32

NAS1149C0332R S019350 5

D4753-1 8164991 16

0 0 0

1,922 0 0

205 0 0

137 0 0

15 0 0

59 0 0

10 0 0

3 0 0

150 0 0

4,666 0 0

42 0 0

300-Packaging

Part Specifications

Specifications could not be found.

Plex 10/23/17 3:24 PM dart.Michaud-Febrille.Victoria

ST 527
001043

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QS1042) Approval	
Description Work Order Deviation		Disposition			Completed By
					Lead hand / Supervisor Approval Verification
					QC / QA Coordinator Approval
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : _____			

ITEM	QTY	P/N	DESCRIPTION
	X	D4680-041	SKIDTUBE
1	1	D2965	CAP
2	1	D2965-3	CAP
3	1	D4680-043	SKIDTUBE SUB ASSY
4	2	AN3C5A	BOLT
5	2	AN526C1032R10	SCREW
6	2	NAS1149C0332R	WASHER

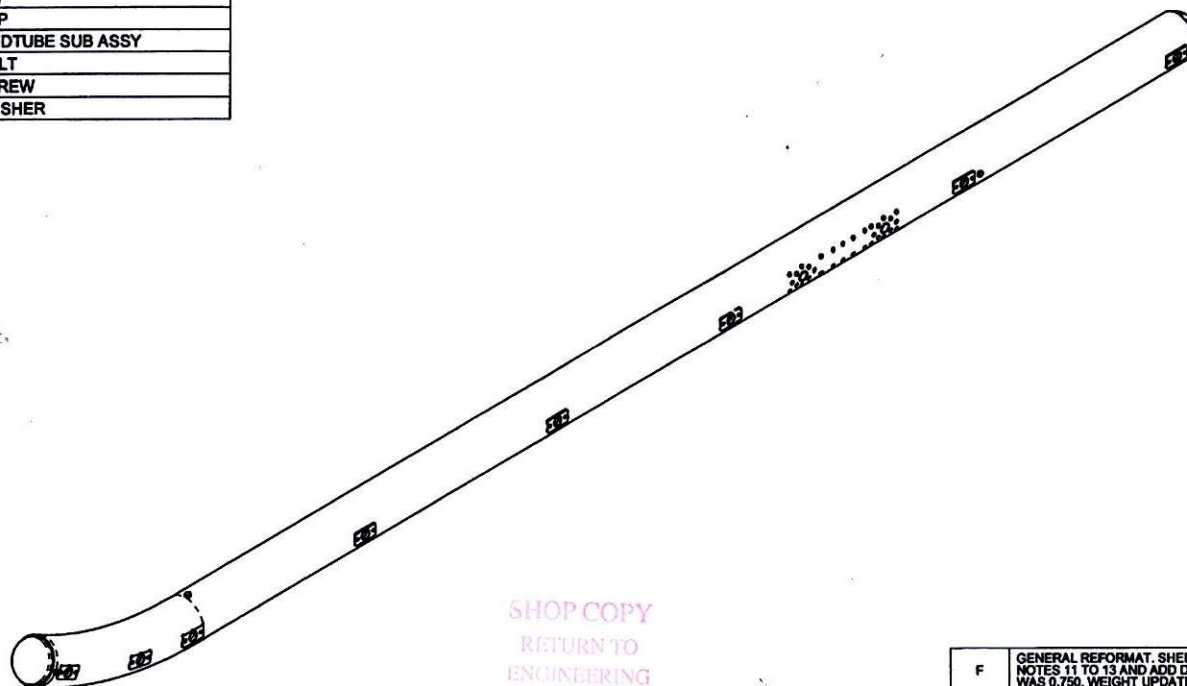

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 167059-A

U4 - 17/10/25

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: PAINT TOP SURFACE OF SKIDTUBE WITH MIL-W-5044 ANTI-SKID PAINT (WING WALK) AS INDICATED TO 1.00 ABOVE CENTERLINE PER QSI 005 SECTION 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY WITH DART P/N "D4680-041" AND B/N PER QSI 044 METHOD 6.4 ON INNER RADIUS OF SKIDTUBE BEFORE INSTALLING D2965 CAP
- 7) WEIGHT: 19.3 lbs
- 8) SEAL FAYING SURFACES WITH SIKAFLEX -241/-291 OR PROSEAL 890/1422 OR MIL-S-8802 CLASS B-2 SEALANT
- 9) INSTALL FASTENERS WET WITH SIKAFLEX -241/-291 OR PROSEAL 890/1422 OR MIL-S-8802 CLASS B-2 SEALANT

F	GENERAL REFORMAT. SHEET 3: ADD ITEMS 8 & 11 ADD NOTES 11 TO 13 AND ADD DETAIL H. SHEET 5: Ø0.188 WAS 0.750. WEIGHT UPDATE. ADD PROSEAL 1422	AJS	17.03.30
E	GROUND HANDLING CROSSBOLT SPACERS NOW SWAGED, WAS WELDED, REMOVED D3492-055 PLUG ASSEMBLIES	AP	15.11.02
D	MOVED AFT GROUNDING FASTENER HOLE AFT 0.25 DUE TO INTERFERENCE, ADDED NOTE 9 (SHT 1), GROUNDING STRAP WASHERS NOW STAINLESS	AP	15.03.04
C	NAS1149F0332P WAS AN960-10L, AN526C1032R10 WAS AN526C1032-10, FWD GROUNDING STRAP FASTENER MOVED AFT (C2-3), Ø0.750 WAS Ø0.758 (B4-3).	AP	14.07.29
B	FWD CAP WAS D2965 NOW D2965-3. VARIOUS DIMENSIONAL CHANGES. D3492-055 PLUG ASSY WAS D3492-051. SWAGING DIMENSION NOW 0.650 WAS 0.661 (D6-2). ADDED DETAIL H (C2-3). MATERIAL D2962-150 WAS D2962-131 (A7-3). GROUND HANDLING THRU HOLES NOW WELDED. ADDED SECTION G-G (D3-2)	AP	13.09.10
A	NEW ISSUE	AP	13.02.13
REV.	DESCRIPTION	BY	DATE
DESIGN	AP	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	AJS		
CHECKED	ML	DRAWING NO.	REV. F
MFG. APPR.	DP	D4680	SHEET 1 OF 5
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	SKIDTUBE	NTS
DATE	17.03.30	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED
2017-08-11
ECN 17-547

APPROVED

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																											
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																								
Description Work Order Deviation				Disposition				Completed By																																																							
								Lead hand / Supervisor Approval Verification																																																							
								QC / QA Coordinator Approval																																																							
Root Cause		FAULT CATEGORY																																																													
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____	
Misidentified ☐	Past Due ☐																																																														


AN526C1032R10
SCREW
2 PL
9

D2965-3
CAP
8

DETAIL A
SCALE 4X

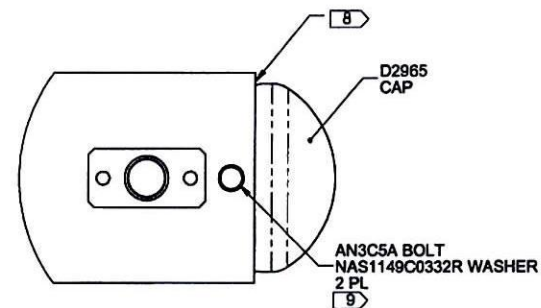

DETAIL B
SCALE 4X

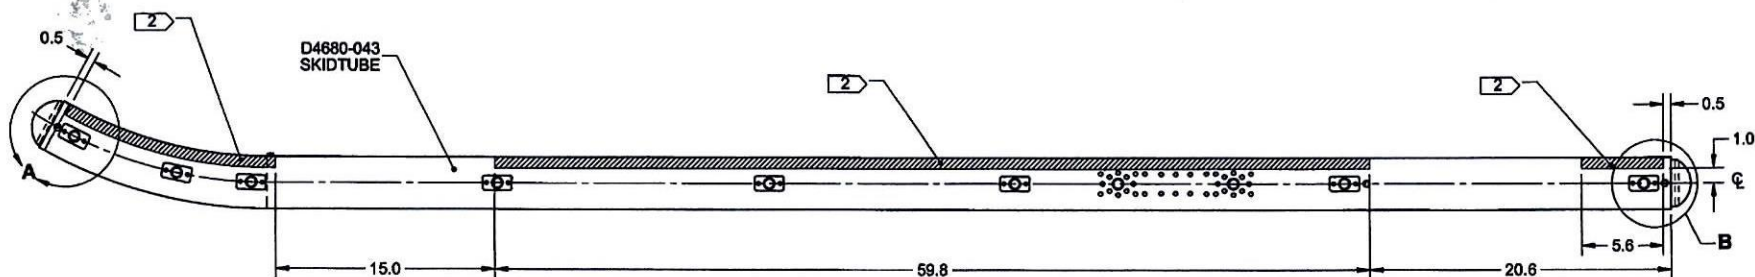

RELEASED
2017-08-11

APPROVED

DESIGN	AP
DRAWN	AJS
CHECKED	ML
MFG. APPR.	DP
APPROVED	WM
DE APPR.	DS
DATE	17.03.30

DART AEROSPACE USA, INC.
EUGENE, OR

DRAWING NO.	REV. F
D4680	SHEET 2 OF 5
TITLE	SCALE
SKIDTUBE	NTS

COPYRIGHT © 2013 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

WORK ORDER NON-CONFORMANCE / UPDATE





QA Closed: _____ Date: _____

Work Order update only

Work Order: _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS							
Part No. _____				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐				
				Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐				
NCR No. _____				Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐				
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval			
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval			
Root Cause Environment ☐ No Re-verification ☐ Design ☐ Operator ☐ Doc/Data ☐ Offset/Setup ☐ Equip/Tooling ☐ Supplier ☐ Handling/Pre ☐ Training ☐ Material ☐ Use for Testing ☐ Internal Transport ☐ Poor Information ☐ Tribal Knowledge ☐ Rushing ☐ LOA ☐ Product Improvement ☐ Substation ☐ Process Improvement ☐ Past Expiry Date ☐ Manufacturing Process ☐ Misidentified ☐ Past Due ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Temperature/Cure ☐ Power Loss/Surge ☐ Positioned Wrong ☐ Bending ☐ Set-up ☐ Folio/Program ☐ Outside Dimensions ☐ Centre Not Concentric ☐ BOM/Route ☐ Grain ☐ Over/Under tolerance ☐ Cracks ☐ Broken/Damage/Defect ☐ Weld ☐ Part Incorrect ☐ Crimp/Kink/Ripple/Wave ☐ Inspection Incomplete/Unqualified ☐ Wrong Stock Pulled ☐ Part Lost/Missing ☐ Cuffs ☐ Contamination ☐ Out of Sequence ☐ Part Moved ☐ Crushing ☐ Countersink ☐ Off-set ☐ Drawing ☐ Heat Treat ☐ Cut Too Short ☐ Mislabeled ☐ Finish ☐ Wave/Twist in Tube ☐ Instructions Incomplete/Unclear ☐ Fit/Function ☐ Misread ☐ Marks/Chatter ☐ Drill Holes ☐ Misaligned/off center ☐ Turning Sequence									
		OTHER :									

ITEM	QTY -043	P/N	DESCRIPTION
	X	D4680-043	SKIDTUBE SUB ASSY
1	1	D4680-1	SKIDTUBE
2	1	D4681-041	WEB ASSY
3	8	D4686-1	SPACER
4	16	D4753-1	DOUBLER
5	2	D5304-1	CROSSBOLT SPACER
6	2	D5520-1	DOUBLER
7	3	AN3C4A	BOLT
8	32	MS20601AD4W3	RIVET, BLIND, CSK
9	3	NAS1149C0332R	WASHER
10	3	AELS-1032-130	INSERT
11	68	CR3212-5-05	CSK RIVET, CHERRY MAX

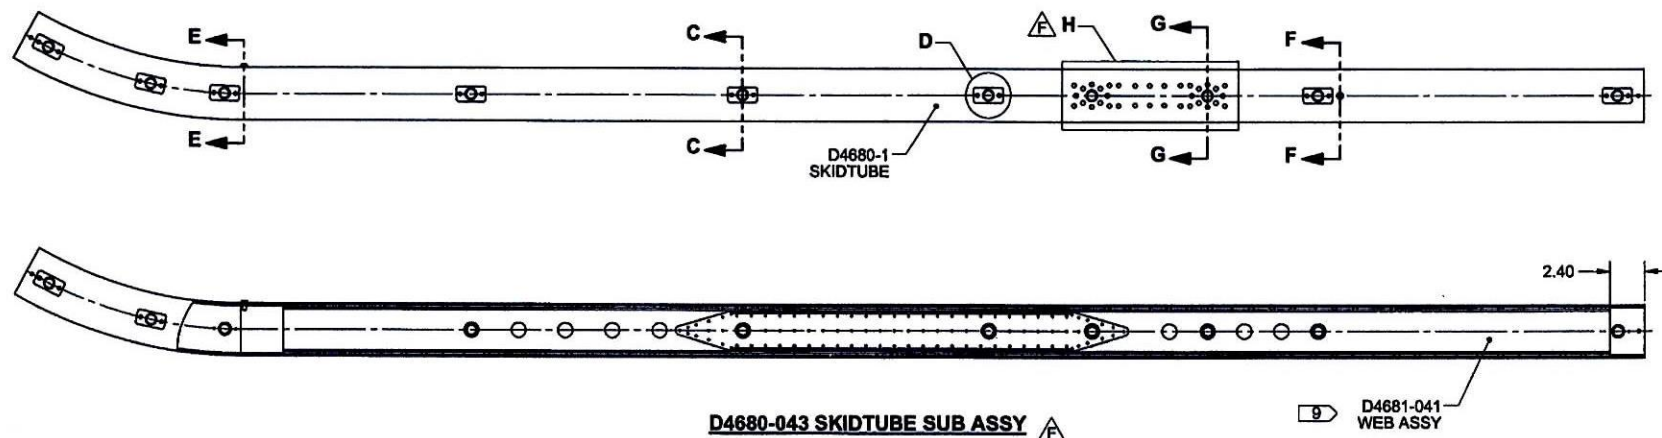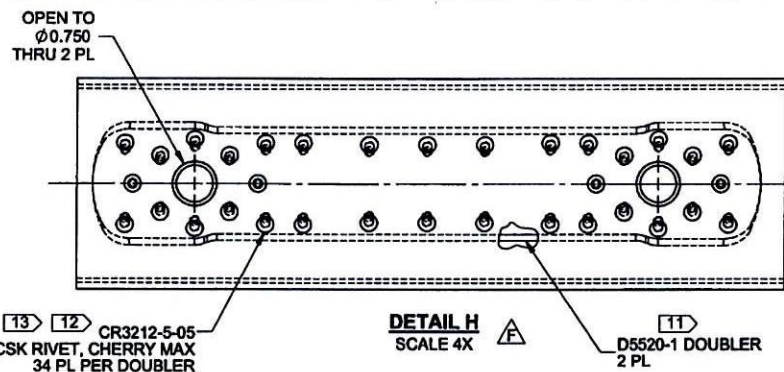

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: APPLY CHEMICAL CONVERSION COATING PER DART QSI 005 4.1 PRIOR TO INSTALLING D4681-041 WEB. POWDER COAT WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: 18.6 lbs
- 8) SEAL ALL MATING SURFACES USING PROSEAL 890/1422 OR MIL-S-8802 CLASS B2 SEALANT
- 9) INSERT D4681-041 WEB INTO D4680-1 SKIDTUBE IN LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX -241/-291 ADHESIVE PER DART QSI 015
- 10) INSTALL D4686-1 SPACER AFTER INSTALLING D4753-1 DOUBLERS
- 11) LOCATE THE D5520-1 DOUBLER USING THE Ø0.188 PILOT HOLES ON THE SKIDTUBE AND DOUBLER
- 12) LOCATE QTY (34) HOLES ONTO THE SKIDTUBE PER D5520-1 DOUBLER AND DRILL Ø0.161 THRU SKIDTUBE AND DOUBLER USING DT10309
- 13) COUNTERSINK THE SKIDTUBE Ø0.286 X 100° (34 PL) AND INSTALL EACH D5520-1 DOUBLER USING QTY (34) CR3212-5-05 CSK RIVETS

RELEASED
2017-08-11

APPROVED

DESIGN	AP	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	AJS		
CHECKED	ML	DRAWING NO.	REV. F
MFG. APPR.	DP	D4680	SHEET 3 OF 5
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	SKIDTUBE	NTS
DATE	17.03.30	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

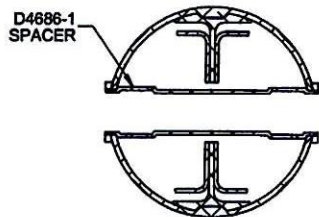

SECTION C-C
SCALE 4X
8 PL

INSTALL D4686-1 SPACER AS FOLLOWS (8 PL)
AFTER INSTALLING D4753-1 DOUBLERS PER DETAIL D


1. INSERT D4686-1 SPACER
2. SWAGE TO $\phi 0.650 +0.010/-0.000$ X 1.0
DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

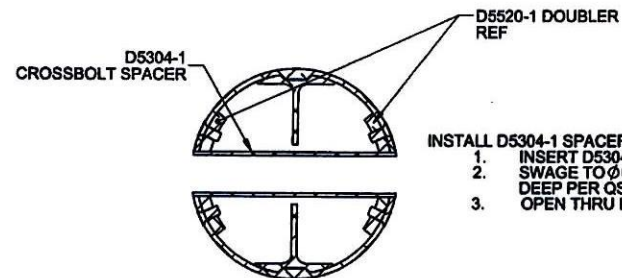


SECTION G-G
SCALE 4X
2 PL

INSTALL D5304-1 SPACER AS FOLLOWS (2 PL)


1. INSERT D5304-1 SPACER
2. SWAGE TO $\phi 0.565 +0.005/-0.000$ X 1.0
DEEP PER QSI 002
3. OPEN THRU HOLE TO $\phi 0.625$

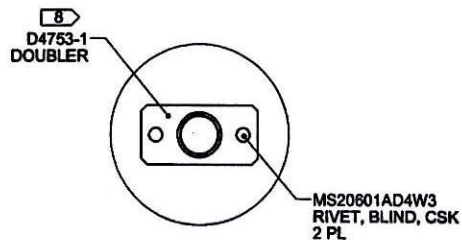

DETAIL D
16 PL (BOTH SIDES)
SCALE 4X

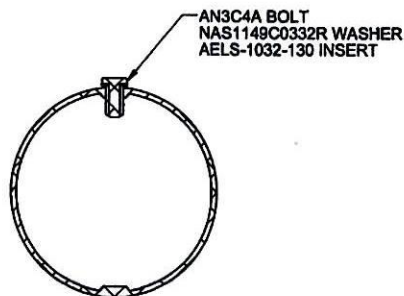

SECTION E-E
SCALE 4X

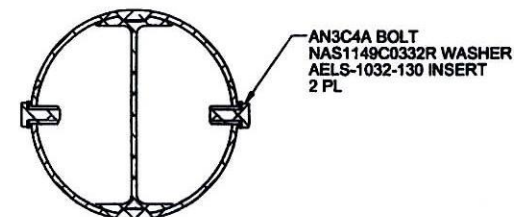

SECTION F-F
SCALE 4X

RELEASED
2017-08-11

APPROVED

DESIGN	AP	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	AJS		
CHECKED	ML	DRAWING NO.	REV. F
MFG. APPR.	DP	D4680	SHEET 4 OF 5
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	SKIDTUBE	NTS
DATE	17.03.30	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QS1042) Approval	
Description Work Order Deviation		Disposition			Completed By
					Lead hand / Supervisor Approval Verification
					QC / QA Coordinator Approval
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : _____	

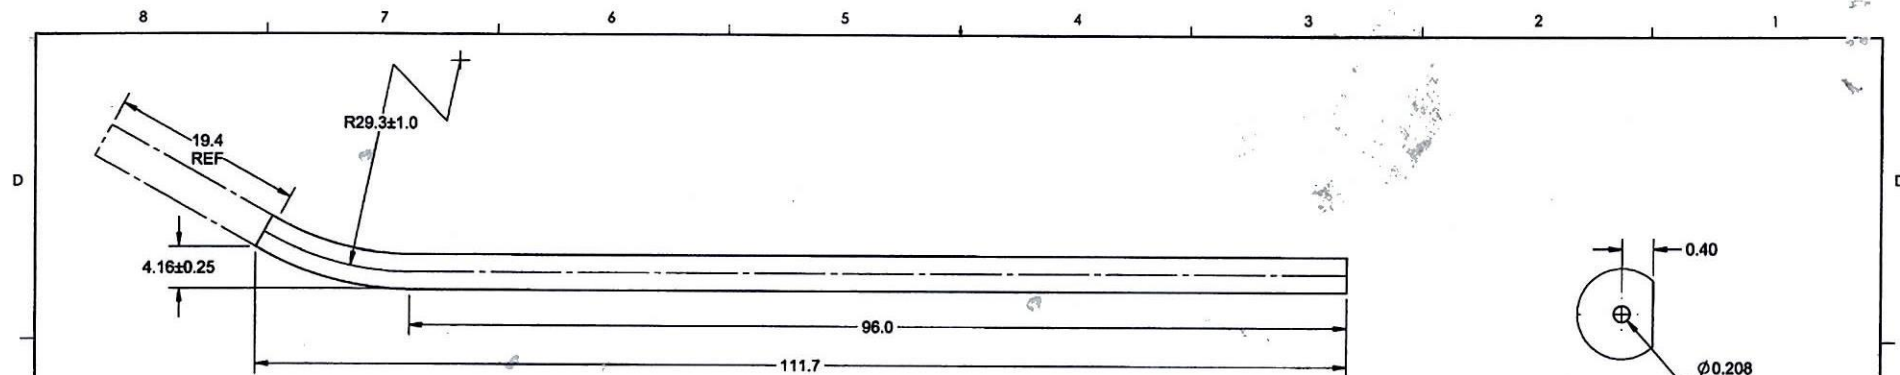


D4680-1 SKIDTUBE BENDING/TRIMMING DETAIL

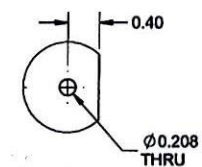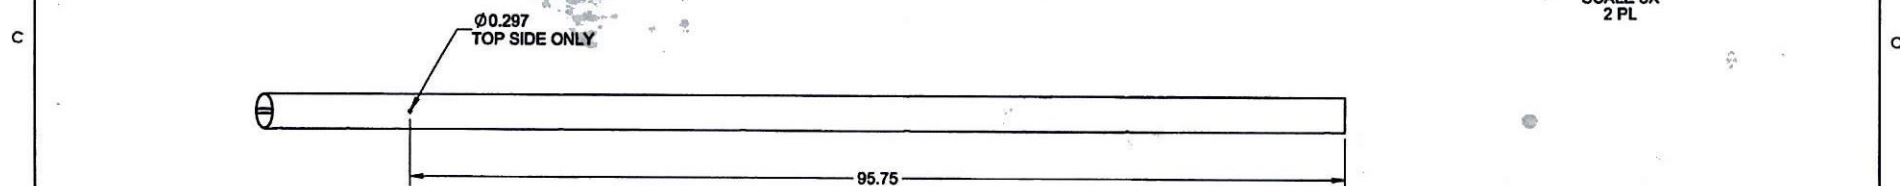


DETAIL J
SCALE 8X
2 PL

2 PL

2 PL

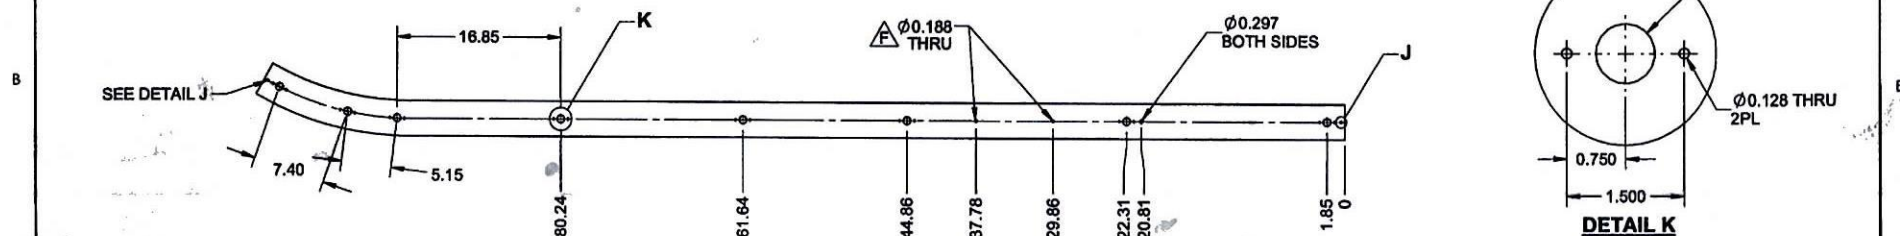

D4680-1 SKIDTUBE DRILLING DETAIL

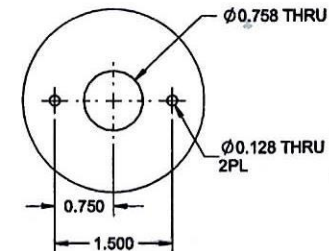

DETAIL K
SCALE 8X
8 PL

8 F

8 F

NOTES:

- 1) MATERIAL: MAKE FROM D2962-150 EXTRUSION
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: 11.36 lbs

DESIGN	AP	DART AEROSPACE USA, INC. EUGENE, OR		
DRAWN	AJS			
CHECKED	MLS		DRAWING NO.	REV. F
MFG. APPR.	DP		D4680	SHEET 5 OF 5
APPROVED	WM		TITLE	SCALE
DE APPR.	DS		SKIDTUBE	NTS
DATE	17.03.30			

COPYRIGHT © 2013 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED IN OR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE USA, INC.

RELEASE
2017-08-11

2017 -08- 11



APPROVED

17.03.30

DART AEROSPACE USA, INC.

EUGENE, OR

DRAWING NO.	
-------------	--

D4680

REV. F

SHEET 5 OF 5

1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45
DATE	TIME	LOCATION	TYPE	STATUS	PRIORITY	ASSIGNED TO	ASSIGNED BY	ASSIGNED DATE	ASSIGNED TIME	ASSIGNED LOCATION	ASSIGNED TYPE	ASSIGNED STATUS	ASSIGNED PRIORITY	ASSIGNED ASSIGNED TO	ASSIGNED ASSIGNED BY	ASSIGNED ASSIGNED DATE	ASSIGNED ASSIGNED TIME	ASSIGNED ASSIGNED LOCATION	ASSIGNED ASSIGNED TYPE	ASSIGNED ASSIGNED STATUS	ASSIGNED ASSIGNED PRIORITY	ASSIGNED ASSIGNED ASSIGNED TO	ASSIGNED ASSIGNED ASSIGNED BY	ASSIGNED ASSIGNED ASSIGNED DATE	ASSIGNED ASSIGNED ASSIGNED TIME	ASSIGNED ASSIGNED ASSIGNED LOCATION	ASSIGNED ASSIGNED ASSIGNED TYPE	ASSIGNED ASSIGNED ASSIGNED STATUS	ASSIGNED ASSIGNED ASSIGNED PRIORITY	ASSIGNED ASSIGNED ASSIGNED ASSIGNED TO	ASSIGNED ASSIGNED ASSIGNED ASSIGNED BY	ASSIGNED ASSIGNED ASSIGNED ASSIGNED DATE	ASSIGNED ASSIGNED ASSIGNED ASSIGNED TIME	ASSIGNED ASSIGNED ASSIGNED ASSIGNED LOCATION	ASSIGNED ASSIGNED ASSIGNED ASSIGNED TYPE	ASSIGNED ASSIGNED ASSIGNED ASSIGNED STATUS	ASSIGNED ASSIGNED ASSIGNED ASSIGNED PRIORITY	ASSIGNED ASSIGNED ASSIGNED ASSIGNED ASSIGNED TO	ASSIGNED ASSIGNED ASSIGNED ASSIGNED ASSIGNED BY	ASSIGNED ASSIGNED ASSIGNED ASSIGNED ASSIGNED DATE	ASSIGNED ASSIGNED ASSIGNED ASSIGNED ASSIGNED TIME	ASSIGNED ASSIGNED ASSIGNED ASSIGNED ASSIGNED LOCATION	ASSIGNED ASSIGNED ASSIGNED ASSIGNED ASSIGNED TYPE	ASSIGNED ASSIGNED ASSIGNED ASSIGNED ASSIGNED STATUS

SKIDTUBE

SCALE

SCALE
NTS

COPYRIGHT © 2013 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coor. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			Completed By
					Lead hand / Supervisor Approval Verification
					QC / QA Coordinator Approval
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					